



Title:

Mandatory Service Bulletin - Wing Pin Washers

Document number:

SB_SONG_01

Title	Document no.	Revision	Page	Pages
Mandatory Service Bulletin - Wing Pin Washers	SB_SONG_01	R00	1	3

1. Date

24.10.2024

2. Subject


Inner wing pins may got unsecured.

3. Affected s.n.

All

4. Reason


During the preflight check, after the serie of high speed taxing (50km/hod) on the grass RWY a front pin was observed unsecured. Because of vibration, the pin slipped off thru the groove in the pin handle.

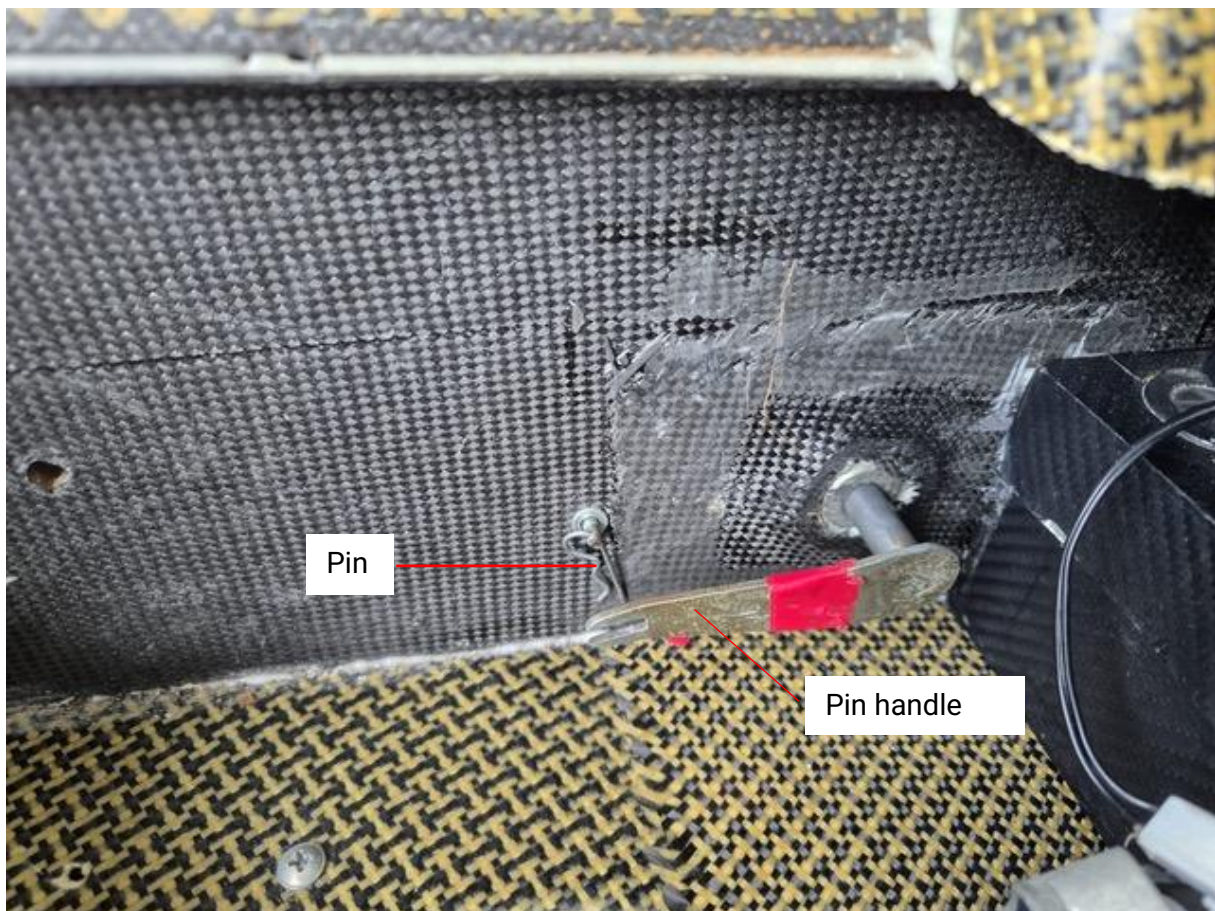

Title	Document no.	Revision	Page	Pages
Mandatory Service Bulletin - Wing Pin Washers	SB_SONG_01	R00	2	3

5. Correction

- 1) Check what type of pin handle is used in your SONG.
- 2) If you have a handle without the groove (just with a round hole) then, no further action is required.
- 3) If you have a handle with the groove, insert a washer between the handle and the pin to secure it.

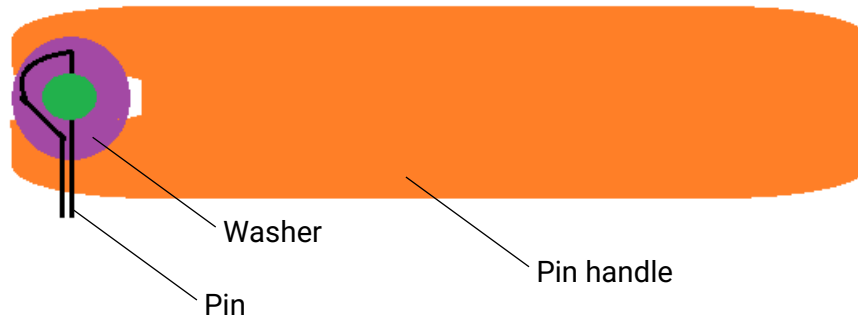

6. Time of compliance

Before the next flight.

7. Performed by

Owner/Operator

8. Expenses covered by

Owner/Operator

9. Documentation

Log this service bulletin into the airplane maintenance log book when it's done.

Title	Document no.	Revision	Page	Pages
Mandatory Service Bulletin - Wing Pin Washers	SB_SONG_01	R00	3	3